

## Please give copies to all Technical Bulletin

Subject: MIL is ON, DTCs P1411, P1423 are Stored in DTC

Memory


Model(s): Touareg

2004 > 2005

Group: **00** 

Number: **05–09** 

Date: Oct. 26, 2005

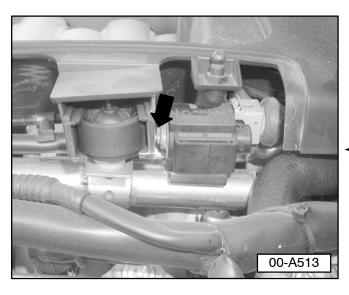

## Condition

Malfunction Indicator Light (MIL) is ON, Diagnostic Trouble Codes (DTCs) P1411, P1423, Secondary Air Injection System Bank 1, Bank 2, Flow Too Low are stored in DTC memory.

May be caused due to lack of clearance between the engine cover and the Secondary Air Injection Solenoid Valve -N112-.

#### Service

Secondary Air Injection Valve, Solenoid Valve -N112- is damaged when left rear corner of engine cover are installed after service has been performed to engine:

◆ Modify engine cover as follows:




#### Note:

Do not use cutting pliers, damage will occur to cover. A File or Die Grinder is recommended.

### DO NOT remove entire ear of engine cover.


- Remove engine cover and invert.
- Remove support material between cover and ear of cover:
  - File or grind to a depth of 5 mm behind the cover ear (arrows) and remove material as shown.
  - Check engine cover fit, allow approximately 26 mm (1 in.) at point of contact with Air Injection Solenoid Valve -N112-.

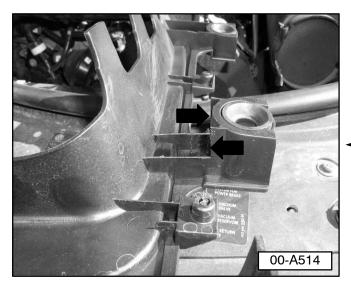

C 00-05-09 1 of 2



# Please give copies to all Technical Bulletin

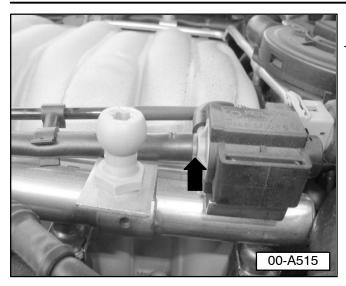

- Inspect and/or replace Secondary Air Solenoid Valve -N112- and vacuum line if damaged.
  - Install all engine covers.
  - Check and erase stored ECM DTCs.
  - Reset Readiness Codes.

When procedure applies to vehicles within the New Vehicle Limited Warranty, use the following: Claim Type: W2 Part Identifier: 1083 **Damage Code:** 1083 11 000 1 10833100 **UT08 Labor Operation: Does Not Include** Secondary Air Solenoid Valve -N112-Replacement, See applicable SRT if necessary **Diagnostic Time:** No Diagnostic Time Allowed Claim Comment: Type "As per Technical Bulletin V000509" in comment section of **Warranty Claim** 

C 00-05-09 2 of 2