



Important!
Please give copies to all
your VW Technicians

Technical Bulletin

Vehicle Delivery Information

**Subject: Front Disc Brakes, Replacing Brake Pads For
Intermittent Squeal**

Group: 46

Number: 04-03

**Model(s): Touareg 3.2L V6 (Eng. codes BMX, BAA) 2005 see VIN Date: Nov. 12, 2004
4.2L V8 (Eng. codes AXQ, BHX) Below**

Condition

Brake pad composition may in time result in intermittent squeal from front brakes.



Tip:

Condition does not affect brake performance.

Production

Brake Pad composition changed as of VIN:
7L_5D038749.

(PPC) Port Processing Centers installed
Brake Pad Kit brake pad kit Part No:
7L0 698 151F (vehicles are identified by a
red dot on inside rearview mirror).

Service

This procedure should be applied as follows:

- Only on 2005 MY vehicles before VIN: 7L_5D038749.
- Only on vehicle with the above listed engine configurations.
- Only on vehicles without red dot on inside rearview mirror.
- Only on vehicles with 17 inch rotors.
- Depending on vehicle disposition (sold & delivered or In Dealer Inventory) see page 2 for instructions.



Important!
Please give copies to all
your VW Technicians

Technical Bulletin

Vehicle Delivery Information

Sold & delivered Vehicles:

If customer returns with concern for brake squeal and vehicle fits configurations listed on page 1:

- Replace front brake pads using brake pad kit Part No: 7L0 698 151F (see Repair Manual *Brake System* Group 46 – Brakes Mechanical components, Front brakes, Brembo 17” and 18” calipers, servicing).



Tip:

Part numbers listed in this bulletin are for reference only. Always check with your Parts Dept. for the latest parts information.

DO NOT replace front brake rotors as they will not be affected by this exchange.

Dealer inventory:

- The following must be performed (during the PDI) on all applicable vehicles as listed on page 1.

Inspect each vehicle for a red dot on the inside rearview mirror.

If mirror has red dot:

- **Do Not** perform this Technical Bulletin.

If mirror does not have red dot:

- Replace front brake pads using brake pad kit Part No: 7L0 698 151F (see Repair Manual *Brake System* Group 46 – Brakes Mechanical components, Front brakes, Brembo 17” and 18” calipers, servicing).



Tip:

DO NOT replace front brake rotors as they will not be affected by this exchange.



Important!
Please give copies to all
your VW Technicians

Technical Bulletin

Vehicle Delivery Information

| | |
|---|----------------------|
| When procedure applies to vehicles within the New Vehicle Limited Warranty, use the following: | |
| Claim Type | W2 |
| Part Identifier: | T636 |
| * Damage Code: | T636 20 xxx 2 |
| Labor Operation: Includes all operations necessary for repair | T6369998 70TU |
| Claim comment: Type "Per Technical Bulletin V460403" in comment section of Warranty claim. | |

*) xxx = vendor code for parts