



Important!

Please give copies to all
your VW Technicians

Technical Bulletin

Subject: **Front Armrest Cupholder, Latch Mechanism
Inoperative**

Group: **68**

Number: **03-03**

Model(s): **Touareg**

2004

Date: **Sept. 17, 2003**



Condition

- ◀ Front armrest cupholder latch mechanism (arrow) is broken, cup holder will not stay latched in the closed position.

CAUTION!

*Part numbers are for reference only.
Always check with your Parts Dept. for
the latest parts information.*

Service

DO NOT replace armrest for this condition.

Latch mechanism can be replaced as follows:

- ◀
- Insert small screwdriver or small pick tool (with a hook at the end) behind locking tabs (arrows) of cupholder latch mechanism.
 - Pry tabs inward and snap away from latch mechanism.
 - Using the hooked pick tool, pull mechanism out of armrest.
 - Install new latch mechanism Part No: 7L6 858 581 into armrest.

