



**Important!**

Please give copies to all  
your VW Technicians

# Technical Bulletin

Subject: **Gas Discharge Headlight System, Coding to Eliminate  
DTC 00492 or 01539**

Group: **94**

Number: **03-02**

Model(s): **Touareg**

**2004**

Date: **Sept. 4, 2003**

## Condition

DTC 00492 or 01539 for gas discharge headlights is stored in DTC memory. Basic setting is blocked.

Vehicles arrive with incorrect headlight coding. Replacement light assemblies may not be coded for the specific vehicle application.

Vehicle may have been improperly moved during headlight adjustment. (see Note on Page 2).

## Service

Use the following procedure to recode the gas discharge headlight system:

- Connect VAS 5051/5052 diagnostic tool to vehicle.
- Switch ignition ON.
- Select "Vehicle self diagnosis" on tester.
- Select "29 - light control left" or "39 - light control right".
- Check coding.

If necessary recode system as follows:

- Select function "07 - code control unit"
- Enter "appropriate coding".
- ◆ 00002 (for standard suspension)
- ◆ 00003 (for pneumatic suspension).
- Press "Q" to confirm.
- Perform basic setting for gas discharge headlight system (see Repair Manual, *Maintenance*).



**Important!**

Please give copies to all  
your VW Technicians

# Technical Bulletin

---

**Note:**

*During adjustment the headlight beam width regulation can only take place with the vehicle already positioned on a level surface with the parking brake off and the transmission in position "N". No movement of the vehicle may take place.*