



Important!

Please give copies to all your VW Technicians

Technical Bulletin

Subject: **Rear Hatch Glass, Open Warning Displayed In Multi-Function Display**

Group: **55**

Number: **05-05**

Model(s): **Touareg**

2004 ▶ VIN: **4_D009400**

Date: **Dec. 20, 2005**

Supersedes T.B. Group 55 Number 04-01 dated June 7, 2004 due to bulletin being removed from Required Vehicle Updates category.

Condition

Instrument cluster multi-function display may flash "Rear Hatch Glass Open" warning.

This warning may be continuous or intermittently displayed.

Service



Tip:

Part numbers listed in this bulletin are for reference only. Always check with your Parts Dept. for the latest parts information.

On all vehicles built prior to VIN: 4D009400:

- Open rear window.
- Remove rear wiper motor trim cover.
- ◀ - Check Part No. -white arrow- on side of rear hatch glass latch -A-.

If rear hatch glass latch Part No. is 7L0 827 506D:

- No Service Action Required. Do Not complete this Technical Bulletin.


If rear hatch glass latch Part No. is 7L0 827 506C:

- Replace rear hatch glass latch. See Repair Manual, *Repair Group 55, Hinged Window Lock, Removing and Installing.*



Note:

Connect an approved VW battery charger while repair is being performed to avoid discharging the battery.

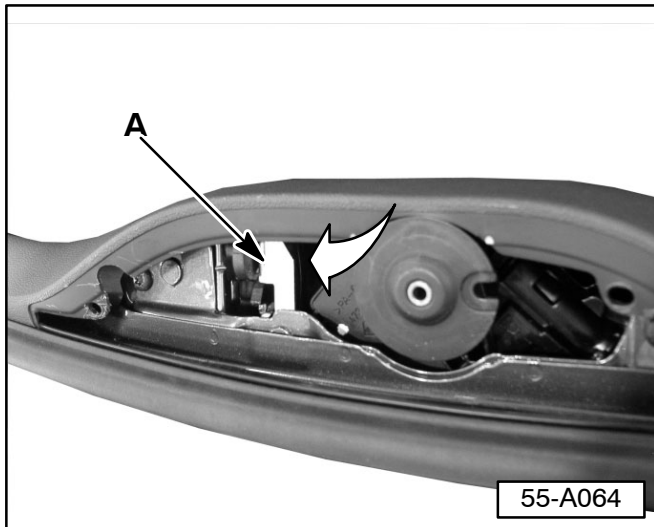



Important!

Please give copies to all your VW Technicians

Technical Bulletin

Ordering Parts

- ◆ Order Part No. **7L6 827 501A** to receive correct part.

| | |
|---|--|
| When procedure applies to vehicles with- in the New Vehicle Limited Warranty, use the following: | |
| Claim Type: | W2 |
| Part Identifier: | 6466 |
| Damage Code: | 6466 40 XXX 2 |
| Labor Operation: Inspect latch assembly, no service action required | 64660100 20TU |
| Labor Operation: Replace rear hatch glass latch | 64665500 80 TU |
| Diagnostic Time: | No Diagnosis Time Al- lowed |
| Claim Comment: Type "As per Technical Bulletin V550505" in comment section of Warranty Claim | |

XXX) Use appropriate vender code