



Important!

Please give copies to all your VW Technicians

Technical Bulletin

Vehicle Delivery Information

Subject: Radio, CD Player Functional Errors

Group: 91

Number: 05-08

Model(s): Touareg (See Table)

2006 ► 7L_6D037266

Date: Dec. 6, 2005

Condition

Radio, CD player intermittently skips, stops or will not play.

Service

Replace radio during PDI under the following conditions:

- **Before** VIN: 7L_6D037266
- Vehicle must be prepped between December 2005 and January 31, 2006
- With software level below HW07/SW16



Note:

Prior to replacing components, record all customer preset radio stations before radio removal.

Similar screen appears:

- ◀ - Determine radio software level using VAS Diagnostic tool (white arrow) or see sticker on radio.

The difference is software (see example below).

Vehicle Self-Diagnosis	56 - Radio
Select diagnosis function	1K0035180A Radio DE2 008 007 0016 Coding XXXXX Dealership number XXXXXX
02 - Interrogate fault memory	1K0035180A
03 - Final control diagnosis	
05 - Erase fault memory	
06 - End output	
07 - Code control unit	
Coding Subbussystem	
08 - Read Measuring Value Block	
10 - Adaption	
16 - Access permission	
Challenge reading out Immob IV	
Enabling Immob IV	
Identification services	
◀	Go to Print ? ⚠
91-A542	

EXAMPLE

Below HW07/SW16	Replace
Equal to, or Above HW07/SW16	Do Not Replace




Important!

Please give copies to all your VW Technicians

Technical Bulletin

Vehicle Delivery Information

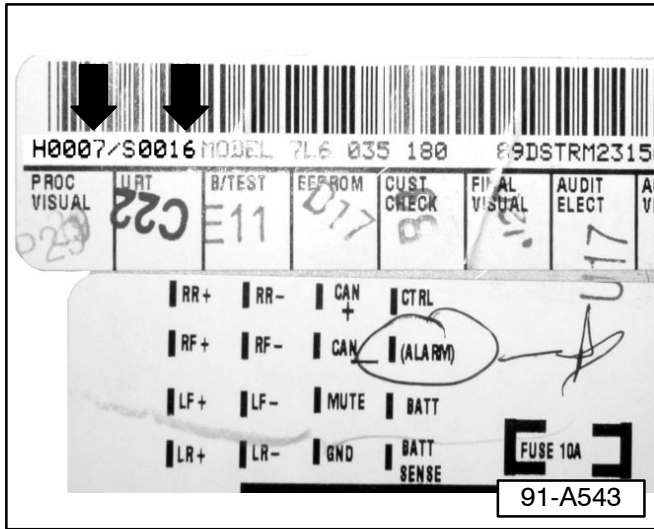

◆ Determining software level in-vehicle, check sticker on radio (black arrow).

If software level is **Below** HW07/SW16 :

- Replace radio (see Repair Manual *Electrical Equipment*, Group 91 – Communication, Radio – Premium Sound System, removing and installing) .

Note:

Replacing radio may lead to DTCs stored in several control modules. Erase all fault memories after radio installation.

Tip:

Part numbers listed in this bulletin are for reference only. Always check with your Parts Dept. for the latest parts information.



Important!

Please give copies to all
your VW Technicians

Technical Bulletin

Vehicle Delivery Information

**When procedure applies to vehicles with-
in the New Vehicle Limited Warranty, use
the following:**

Claim Type:	W2
Part Identifier:	9105
Damage Code:	9105 40 xxx 2
Labor Operation:	91055501 20TU
Diagnostic Time:	No Diagnostic Time Allowed
Claim Comment: Type "As per Technical Bulletin V910508" in comment section of Warranty Claim	

x) Use applicable vender code