



**Important!**

Please give copies to all  
your VW Technicians

# Technical Bulletin

Subject: **Washer Jets (Front or Rear ), Restricted**

Group: **92**

Number: **05-01**

Model(s): **ALL**

**2003 ► 2006**

Date: **Mar. 14, 2005**

## Condition

Window washer spray jet will not spray or has reduced flow because of restriction.

## Service

- Remove restricted nozzle. Refer to Repair Manual Windshield wiper & washer system Group 92 – *Windshield washer jets, removing and installing.*



### Tip:

*When using compressed air to clear the washer jet, blow in direction of flow only.*

- Clear obstruction using compressed air.



### Tip:

*If obstruction can not be cleared, replace the washer jet.*

- Before installing new or original washer jet, flush the washer lines by running the washer pump without the washer jet for 30 seconds.
- Install the new or original washer jet and verify operation. Refer to Repair Manual *Electrical equipment* Group 92 - Windshield wiper & washer system “Windshield washer jets, checking and adjusting”.



# Important!

Please give copies to all your VW Technicians

# Technical Bulletin

<b>When procedure applies to vehicles within the New Vehicle Limited Warranty, use the following:</b>	
<b>Claim Type:</b>	<b>W2</b>
<b>Part Identifier Front:</b>	<b>9266</b>
<b>Damage Code: Front:</b>	<b>9266 16 ____ * _ **</b>
<b>Labor Operation Front:</b>	<b>9266 1900 20 TU</b>
<b>Part Identifier Heated Front:</b>	<b>9263</b>
<b>Damage Code: Heated Front:</b>	<b>9263 16 ____ * _ **</b>
<b>Labor Operation Heated Front:</b>	<b>9263 1900 20 TU</b>
<b>Part Identifier Rear:</b>	<b>9294</b>
<b>Damage Code Rear:</b>	<b>9294 16 ____ * _ **</b>
<b>Labor Operation Rear:</b>	<b>9294 1950 30 TU</b>
<b>Labor Operation Additional for Lift Gate Panel:</b>	<b>7092 1900 30 TU</b>
<b>Claim Comment type "As per bulletin V920501" in comment section of warranty claim</b>	

\*) Code per warranty vendor code policy.

\*\*) Use 1 for repair or 2 for replace.