



Important!

Please give copies to all your VW Technicians

Technical Bulletin

Subject: Exterior Rear View Mirror, Wind Noise Above 50 MPH

Group: 66

Number: 05-01

Model(s): Touareg

2004 ► VIN: 7L_4D071917

Date: Jun. 10, 2005

Condition

Wind noise is heard from the exterior rear view mirror housings at speeds above 50mph.


Production

Improved exterior mirror housing lower trim as of VIN: 7L_4D071917.

Service

◀ The improved housing trim has a spoiler added to the trim surface facing down when installed.

Install new left and right lower mirror housing trims.

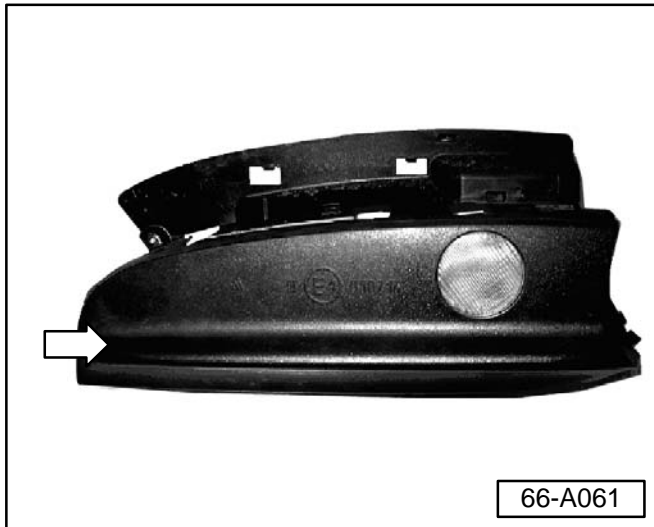

Description	Part No:
Mirror housing trim left	7L6 858 523 E 01C
Mirror housing trim right	7L6 858 524 E 01C
Felt strip kit:	ZVW 269 004



◀ – Apply felt to inside lower edge of housing as shown.

◆ Felt must NOT be visible when housing is reassembled.

 **Tip:**

Part numbers listed in this bulletin are for reference only. Always check with your Parts Dept. for the latest parts information.



Important!

Please give copies to all
your VW Technicians

Technical Bulletin

When procedure applies to vehicles within the New Vehicle Limited Warranty, use the following:	
Claim Type:	W2
Part Identifier:	6655
Damage Code:	6655 20 ___ * 2
Labor Operation: Includes all operations necessary to replace both mirror housings and apply felt strips	6655 3102 50TU
Diagnostic Time:	No Diagnostic Time Allowed
Claim Comment: Type "As per Technical Bulletin V660501" in comment section of Warranty Claim	

*) Code per warranty vendor code policy.